



The DZ Company, LLC  
4321 W. Eisenhower Blvd.  
Loveland, CO 80537  
970-667-2254

## Sienna Construction Note 9/15/09

### Receiver Modification – Rev A boards

1. The output of the 9V regulator, U31, is not connected to the power plane. To fix this, add a short wire between the positive side of tantalum electrolytic capacitor C30 and the hole located to the right of U13, immediately below the text “C99”. See photo below. Use a spare piece of magnet wire or other insulated wire, being careful not to short the wire to any components.

